
JET J-A2608-4 | Stock 354029

Diagram A - Drill Head

Drill Press | Original JET parts reference

Spindelhuvud – Drill head – Bohrkopf

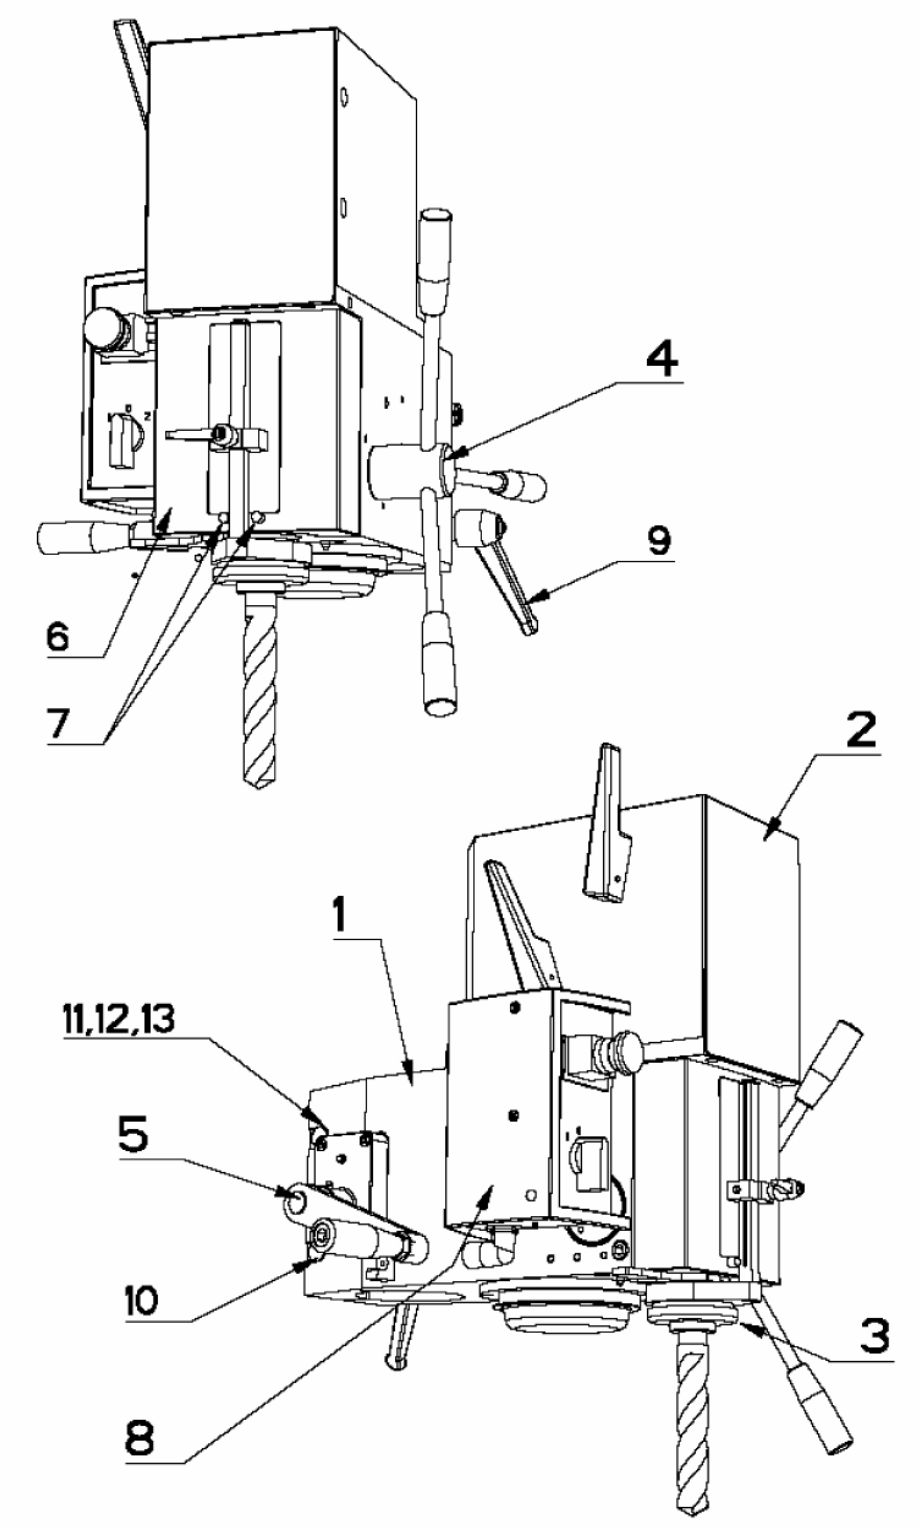

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List A - Drill Head

Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1a	2X08700	Spindle housing	manuell	
1b	2X08700-4	Spindle housing	M	
2a	2X08404	Gear box	manuell	
2b	2X08404-M	Gear box	M	
3	2X08710	Spindle sleeve		
4a	2X08752R	Feed shaft compl.	manuell	
4b	2X08514-1	Feed shaft compl.	M	
5	2X08720-1R	Worm gear unit		
6	2X0870X	Front cover		
7	3P01407	Pin	CP 8x36	
8	4U08705	Electric box cover		
9	3R00014	Locking lever		
10	3S02556	Screw	12x120	
11	3S02558	Screw	12x130	
12	3M09122	Locking nut	M12	
13	3B04178	Washer	13x24x4 11	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.


mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Diagram B - Gear Box

Drill Press | Original JET parts reference

Växellåda – Gear box – Getriebegehäuse

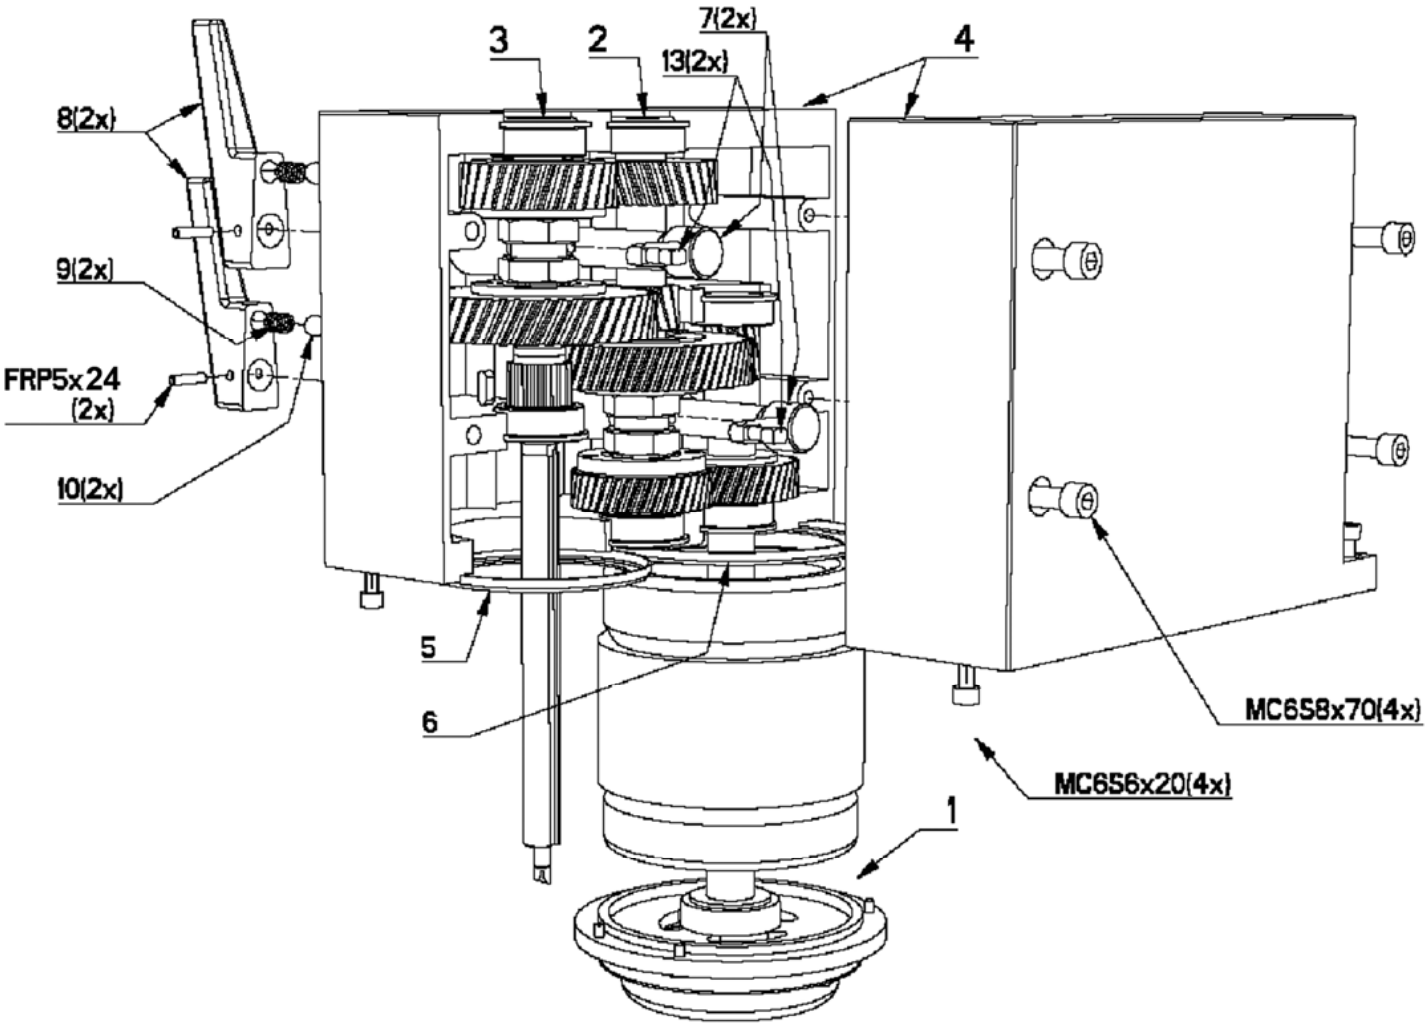

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List B - Gear Box


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	2X08404-1	1:nd shaft complete		
2	2X08404-2	2:nd shaft complete		
3a	2X08404-3	3:rd shaft complete	manuell	
3b	2X08404-5	3:rd shaft complete	M	
4a	2X08422	Gear box complete	manuell	
4b	2X08422-1	Gear box complete	M	
5	4B00174	Ring		
6	4B00173	Ring		
7	2X08536	Gear selector arm		
8	4RS0653-1	Gear lever		
9	4C02921	Gear		
10	3T04028	Steel ball		
13	4T04168	Shift pin		

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

Motoraxel – Engine shaft – Motorwelle

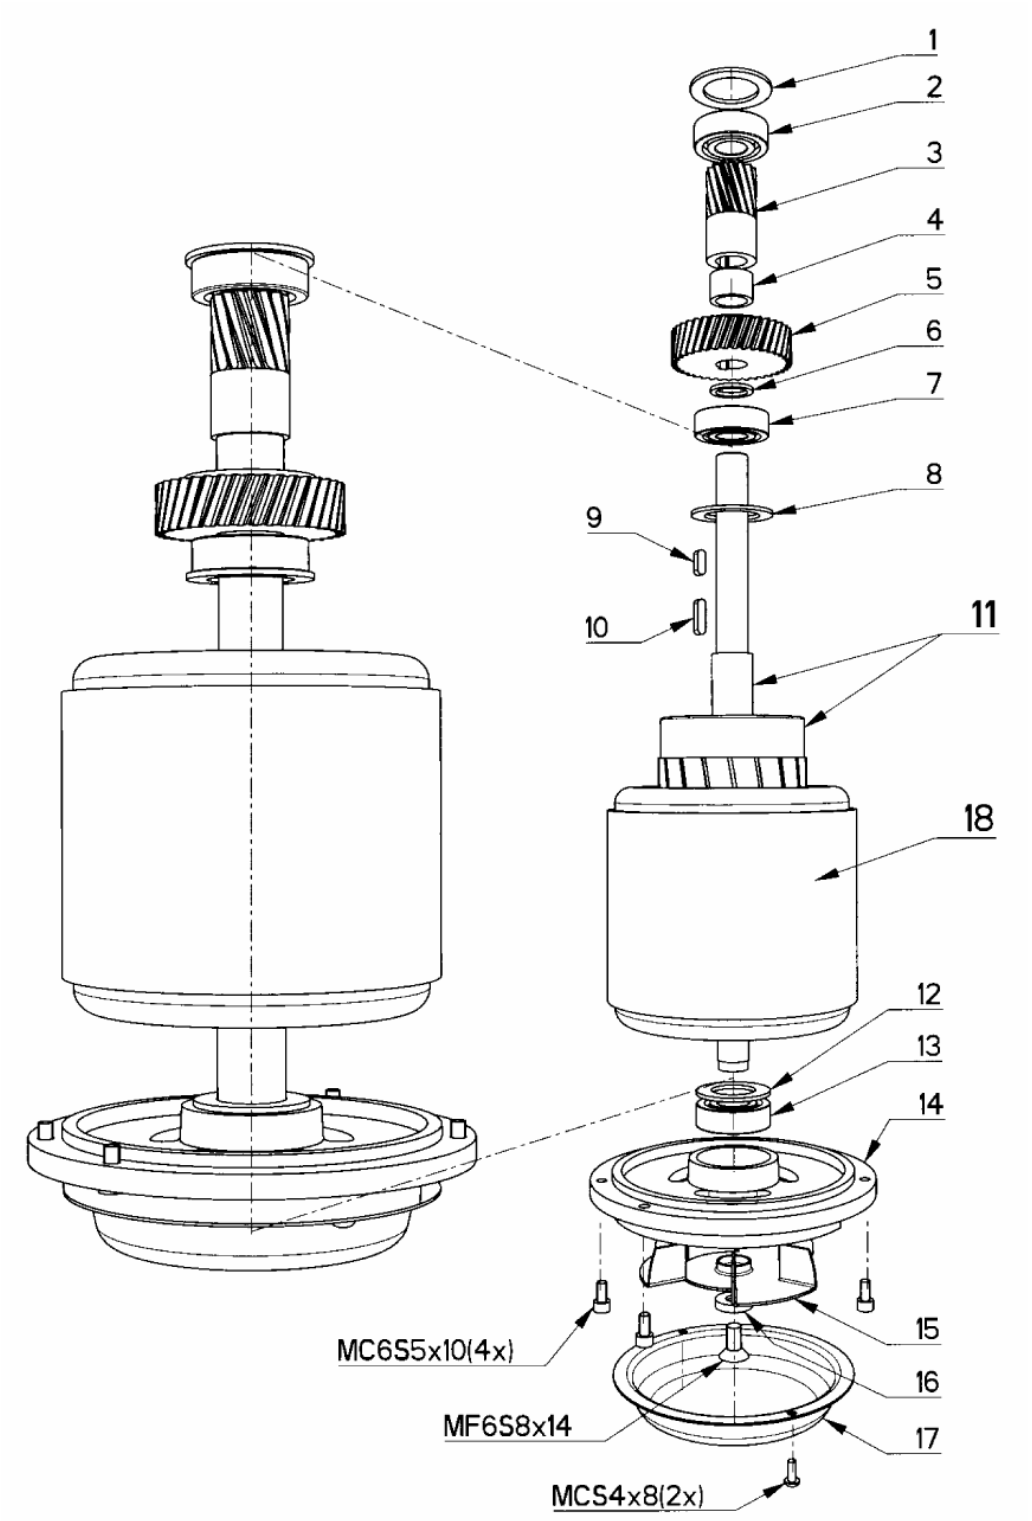

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List C - Engine Shaft


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	4B00137	Washer		
2	3L11003	Ball bearing	6203	
3	2H07969	Gear	15-1,5	
4	2D17014	Spacing sleeve	17x14	
5	2H07972	Gear	39-1,5	
6	2D17002	Spacing sleeve	17x2	
7	3L11003	Ball bearing	6203	
8	4B00137	Washer		
9	3K00184	Key	5x5x14	
10	3K00187	Key	5x5x20	
11	4X08405	Rotor shaft		
12	4F06203	Washer	FB 6203	
13	3L11003	Ball bearing	6203	
14	2N01889	Bearing cover	B-1889	
15	4B00175	Fan	B-175	
16	2B03449	Washer	C-3449	
17	4B01890	Fan cover	C-1890	
18	3E81100	Stator 80/2-4-70	120-575V 13	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

2:a axel – 2:nd shaft – 2:e Welle

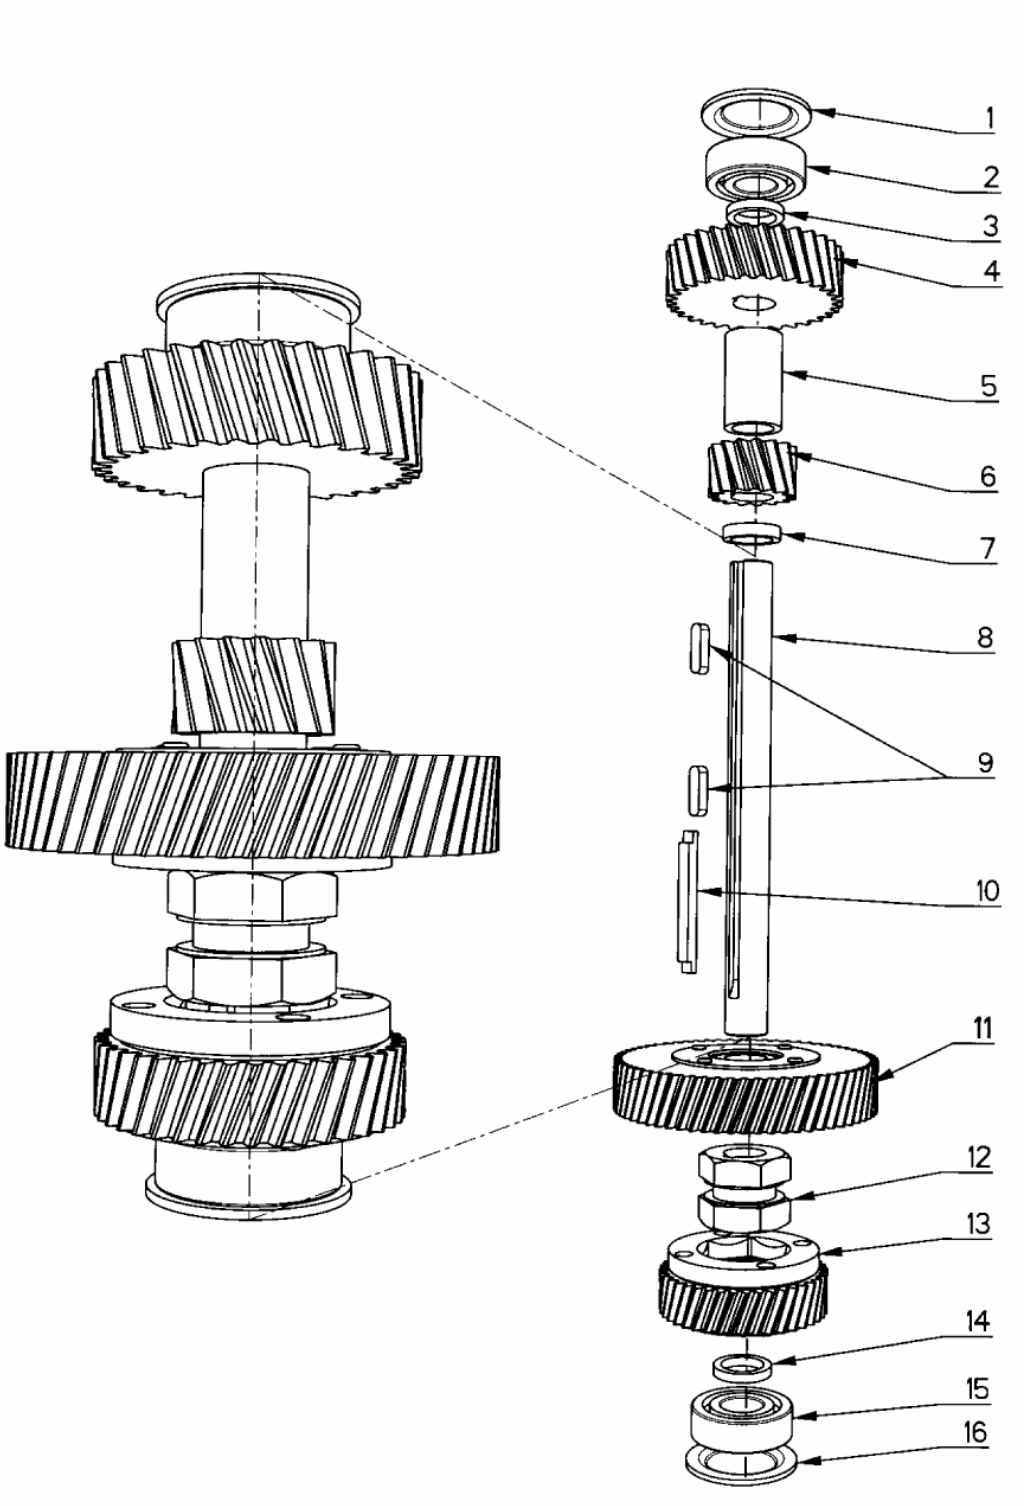

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List D - 2:Nd Shaft


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	4B00138	Washer	C-138	
2	3L11003	Ball bearing	6203	
3	2D00009	Spacing sleeve	17x3,5	
4	2H07971	Gear	32-2	
5	2D17038	Spacing sleeve	17x38	
6	2H07970	Gear	15-2	
7	2D00013	Spacing sleeve	17x5	
8	2A04871	2:nd shaft	C-4871	
9	3K01187	Key	5x5x20	
10	2T06615	Key	C-6615	
11	2X08408R	Gear complete	64-1,5	
12	2T04254	Clutch	C-4254	
13	2X08406R	Gear complete	40-1,5	
14	2D00009	Spacing sleeve	17x3,5	
15	3L11003	Ball bearing	6203	
16	4B00138	Cover	C-138	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

3:e axel – 3:rd shaft – 3:e Welle

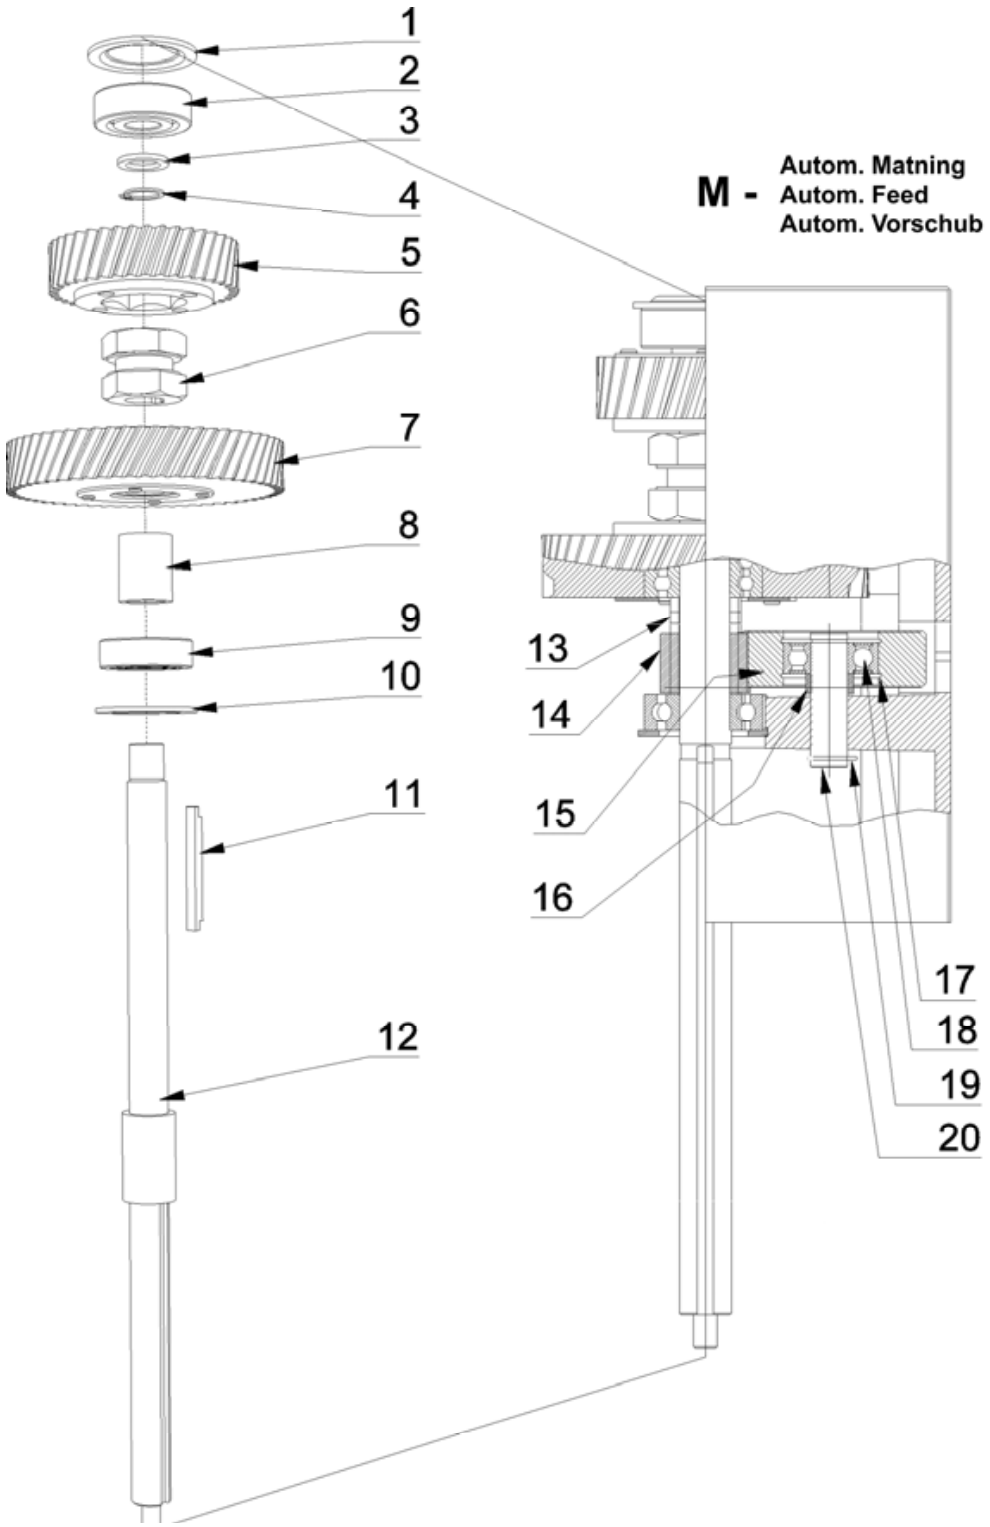

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List E - 3:Rd Shaft

Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	4B00138	Cover	C-138	
2	3L16002	Ball bearing	6302	
3	2D15002	Spacing sleeve	15x2	
4	3C01117	Circlip	SgA 15	
5	2X08413R	Gear complete	32-2	
6	2T04254	Clutch	C 4254	
7	2X08411R	Gear complete	49-2	
8	2D00006	Spacing sleeve	17x31,5	
9	3L11003	Ball bearing	6203	
10	4B00137	Cover	C-137	
11	2T06615	Key	C-6615	
12	2A08410	3:rd shaft	B-8410	
13a	2D00011	Spacer	17x4,5, 2 st/pcs	
13b	2D00009	Spacer	17x3,5, 1 st/pc	
14	2HSB7501-1	Gear wheel	18-1,5	
15	2X08558	Gear complete feed		
16	4D12006	Spacer	12x6,5	
17	3C02131	Circlip	SGH32, 2st/pcs	
18	3L13001	Bearing	6201 2Z	
19	3C01114	Circlip	SGA 12	
20	2A08441	Feed gear shaft	15	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.


mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Diagram F - Column

Drill Press | Original JET parts reference

Pelare – Column – Säule

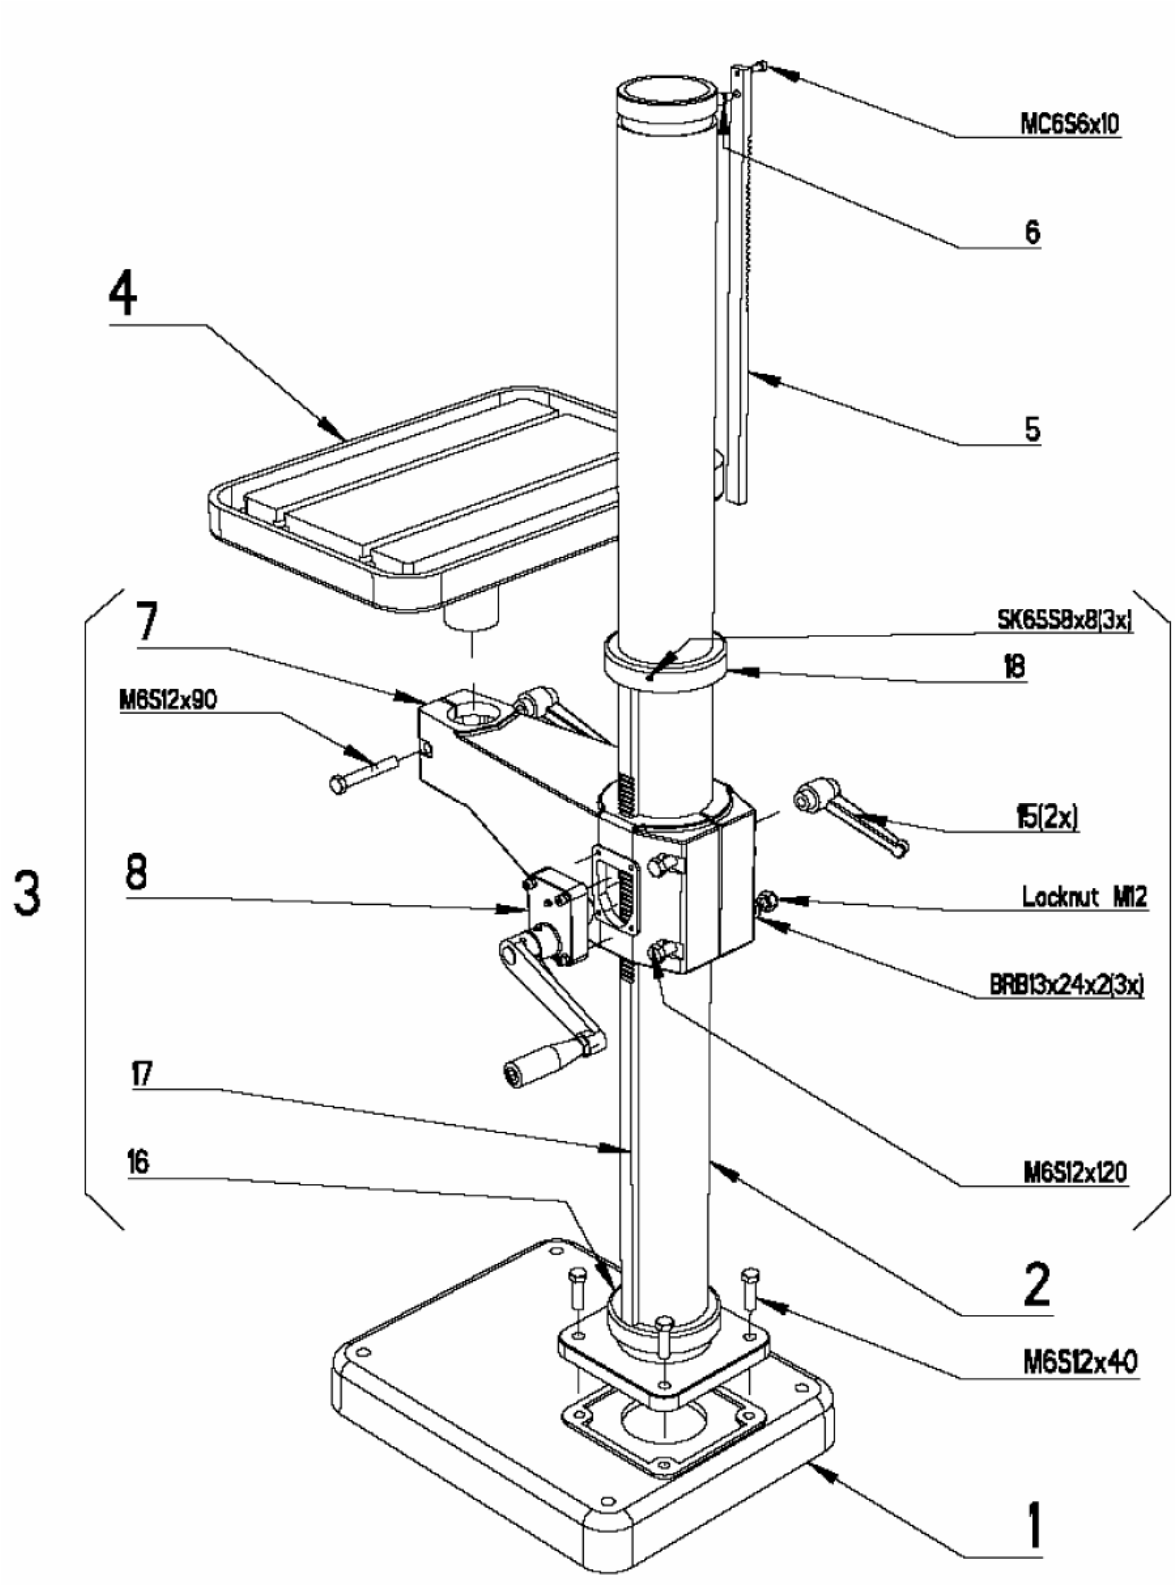

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List F - Column


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	1B03013	Base plate		
2	4X08300	Column	L=1500	
3	2X08723	Table arm complete		
4	2WS1231	Table		
5	2X08445	Rack		
6	2T07146	Pin		
7	2Y08723	Table arm		
8	2X08720-1R	Worm gear complete		
16	2N00186R	Lower ring		
17	2I03598	Rack		
18	2N03668R	Upper ring		

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

Pelare bänk – Column bench type drill – Säule Tischbohrmaschine

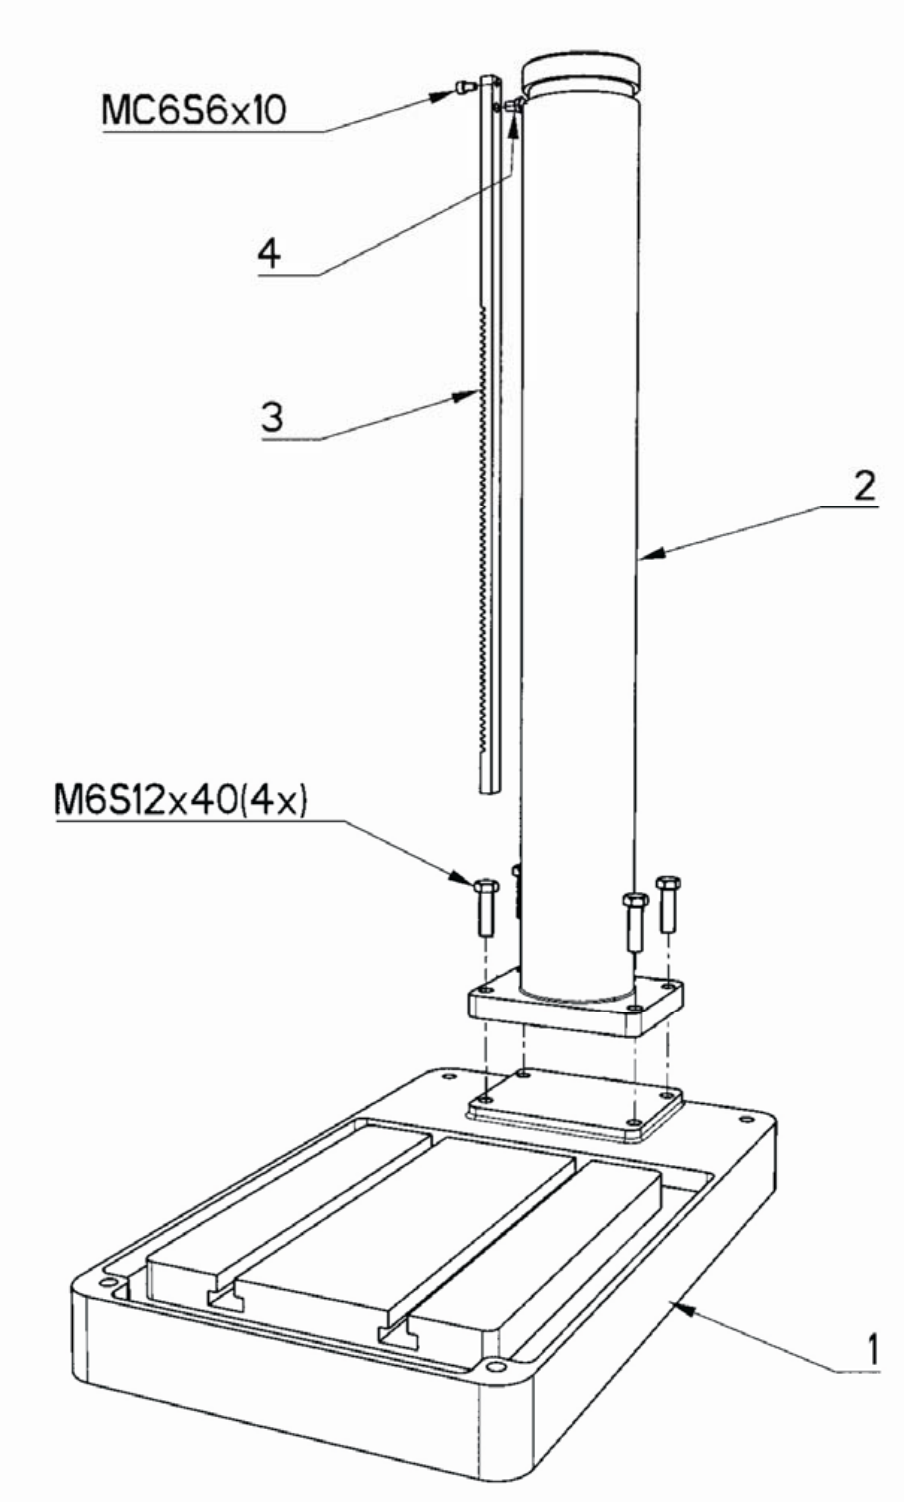

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List G - Column Bench


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	1B03016	Base plate		
2	4ZS1232	Column		
3	2X08545	Rack		
4	2T07146	Pin	17	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

2X08720 – Snäckväxelhus kompl. – Worm gear box compl. – Schneckengetriebegehäuse kompl.

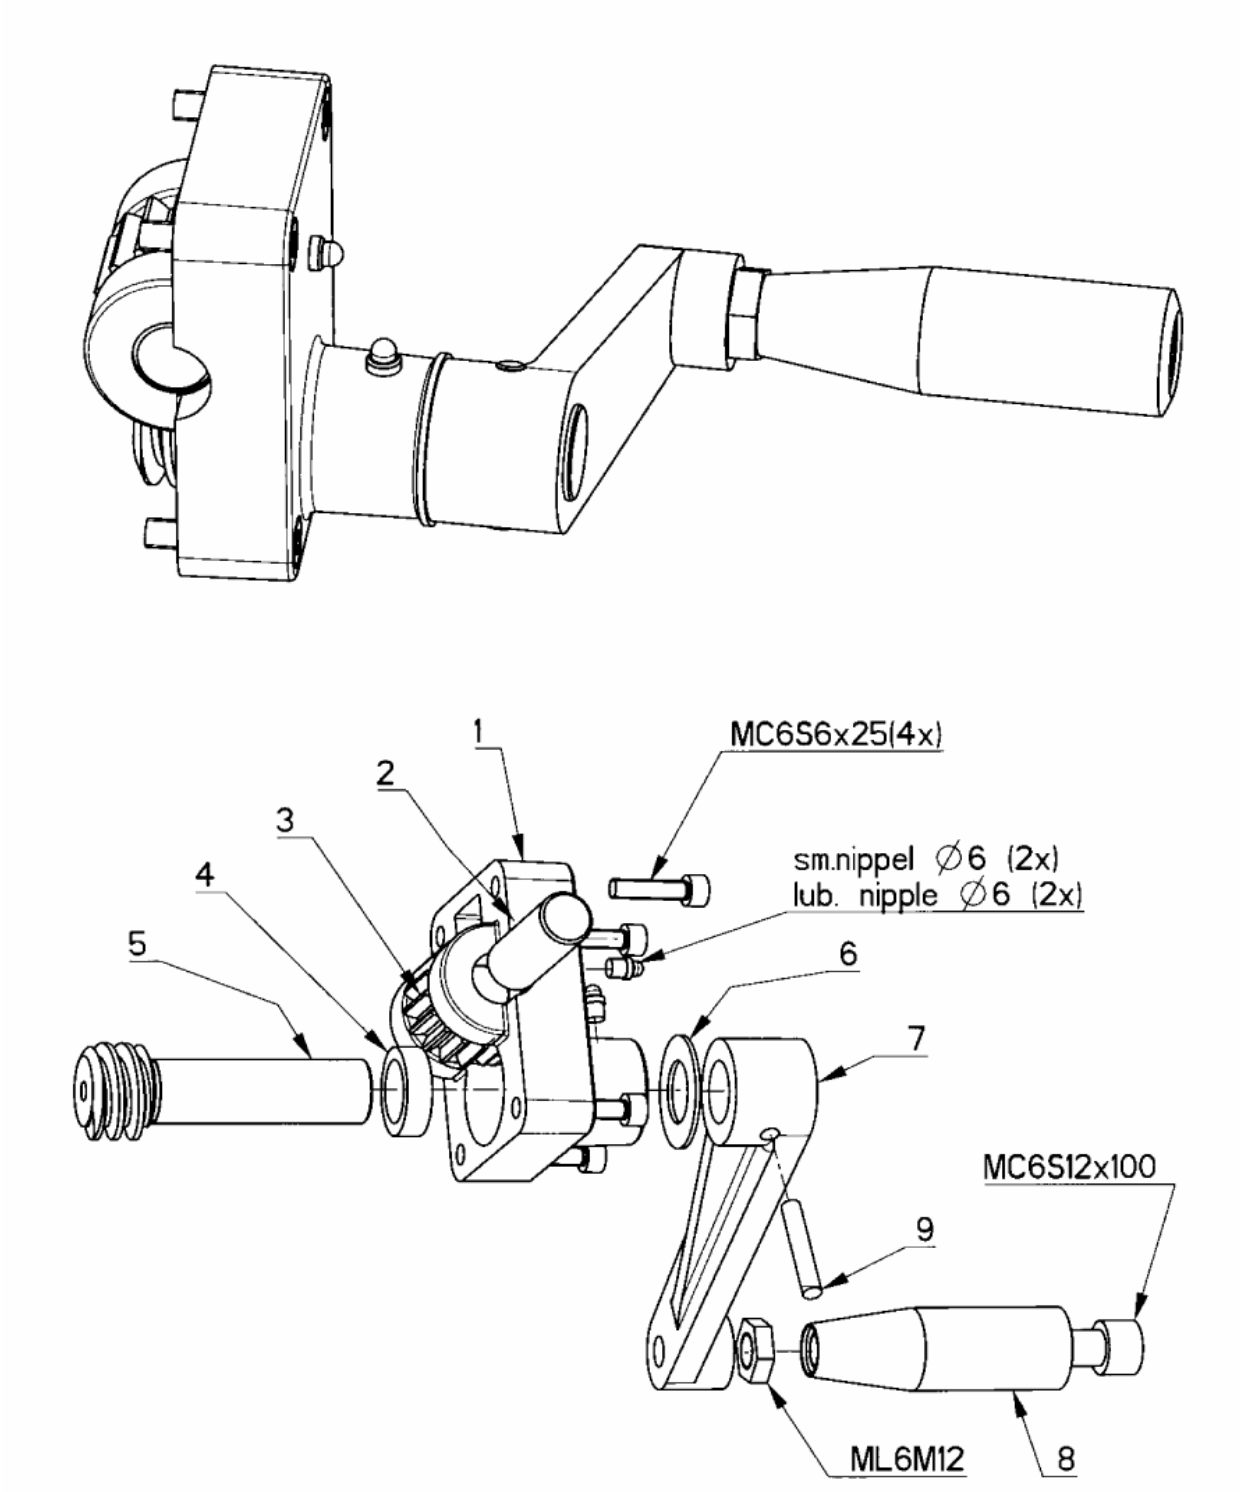

JET J-A2608-4 | Stock 354029

Parts List H - Gear Box

Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	2N08720	Worm gear box		
2	2A08725	Shaft		
3	2HS1201	Gear		
4	2D20008	Spacer	20x8	
5	2IS1203	Worm shaft		
6	3L00021	Washer		
7	2RS1182	Crank		
8	3R01106	Handle		
9	3S04444	Screw	SK6SS 8x8	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.


mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Diagram I - Feed Shaft

Drill Press | Original JET parts reference

Matningsaxel (manuell) – Feed shaft (manual) – Vorschubwelle (manuell)

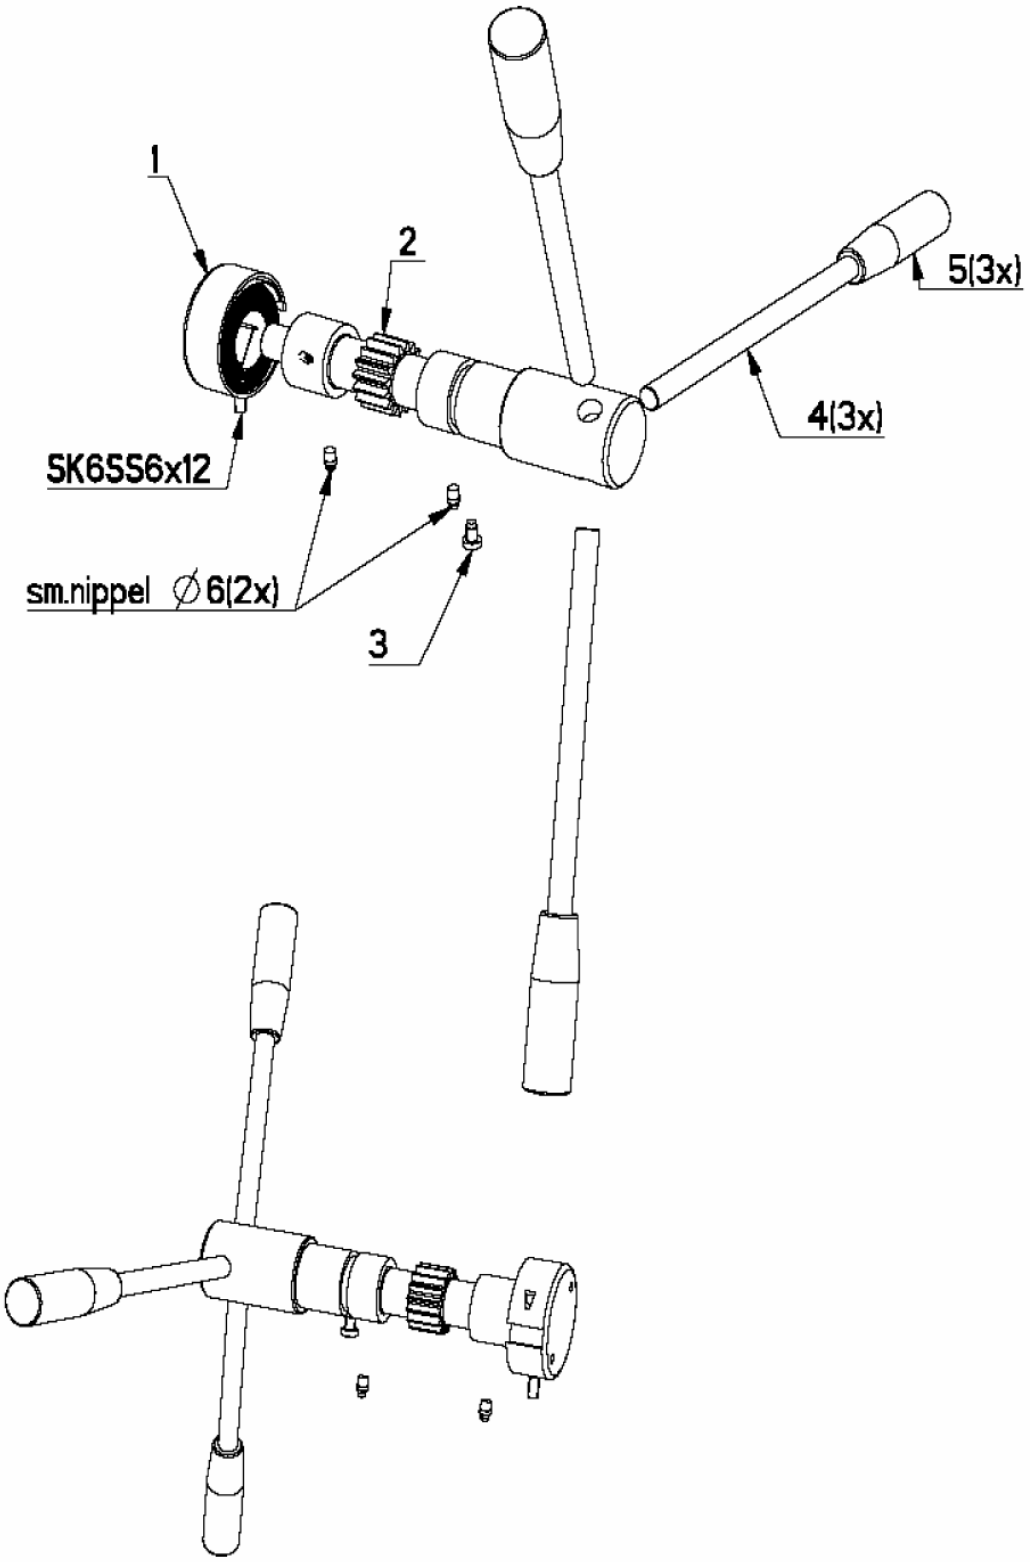

JET J-A2608-4 | Stock 354029

Parts List I - Feed Shaft


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	4XS2150	Spring housing cpl.		
2	2I08752	Feed shaft		
3	4S04211	Pin screw		
4	2E08758	Feed lever	3 st/pcs	
5	3R04004	Handle	3 st/pcs 19	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

Spindelhylsa – Spindle sleeve – Spindelhülse

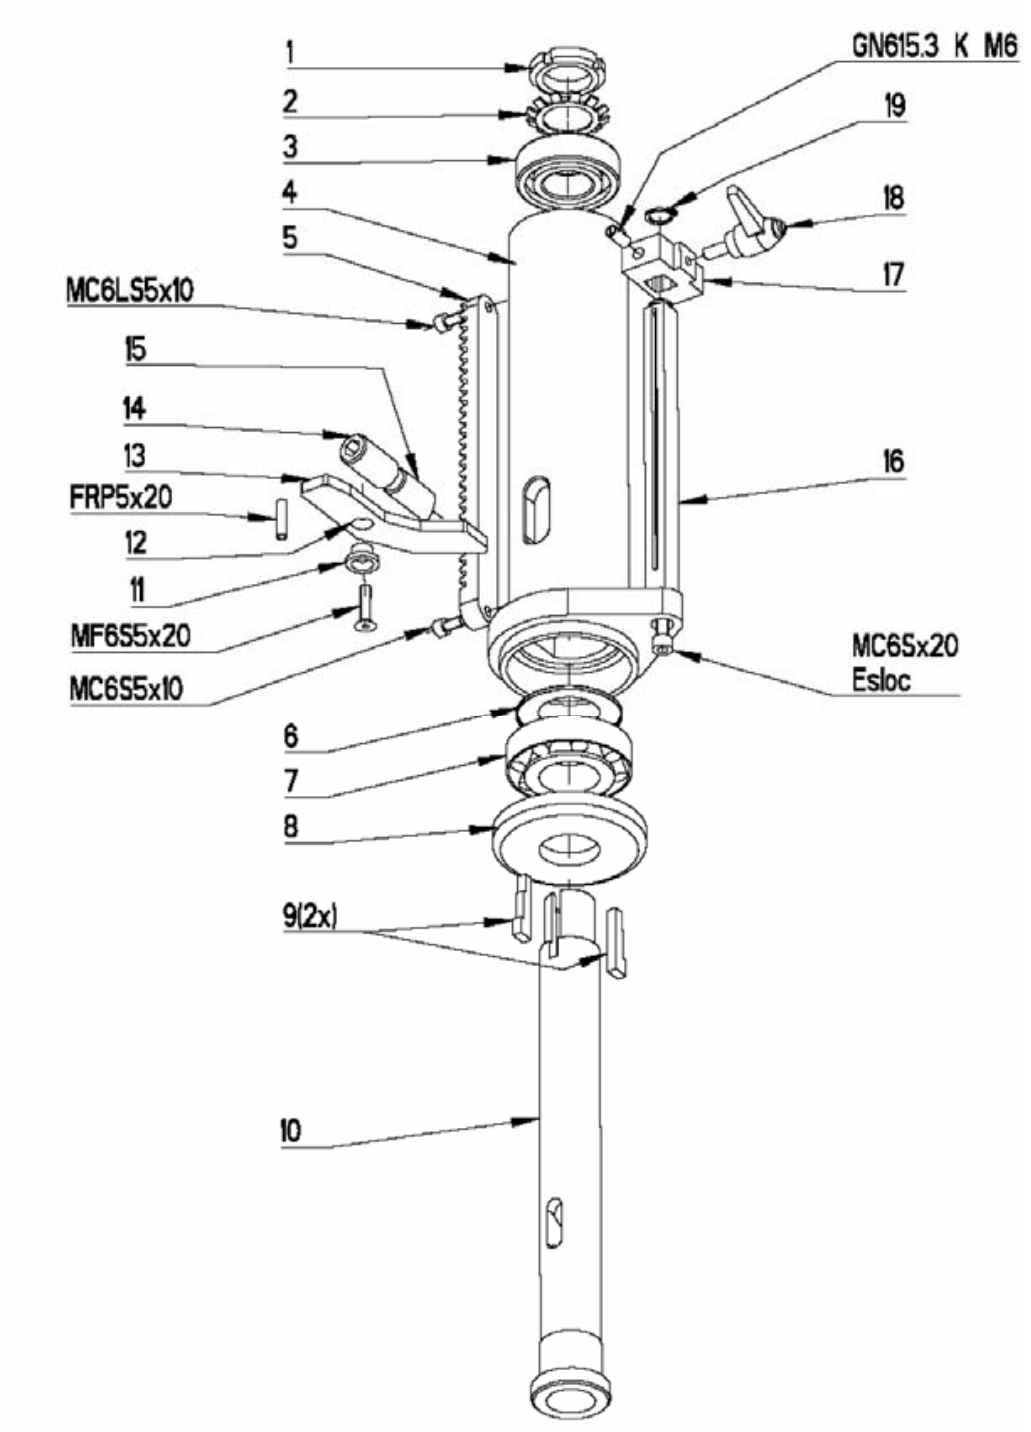

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List J - Spindle Sleeve


Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	3M06005	Nut	MK 5	
2	4B00155	Locking washer		
3	3L15005	Ball bearing	6205	
4	2G08710	Spindle sleeve		
5	2I08753	Rack		
6	4B03769	Washer		
7	3L51006	Taper roller bearing	30206	
8	2TS1106	Roller bearing cover		
9	2T08386	Key		
10	2A08418-1R	Spindle		
11	2T08593	Spacing sleeve		
12	3B06003	Washer		
13	2T08547	Stop		
14	3S08622	Screw	P6SS 16x25	
15	2T08714	Collet jaw		
16	2A08755	Depth gauge rod		
17	2T08757	Stop		
18	3R00002	Locking lever	M6x16	
19	3C01114	Circlip	SgA12	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com

2X08705 – Ellåda – Electric Box – Elektrokasten

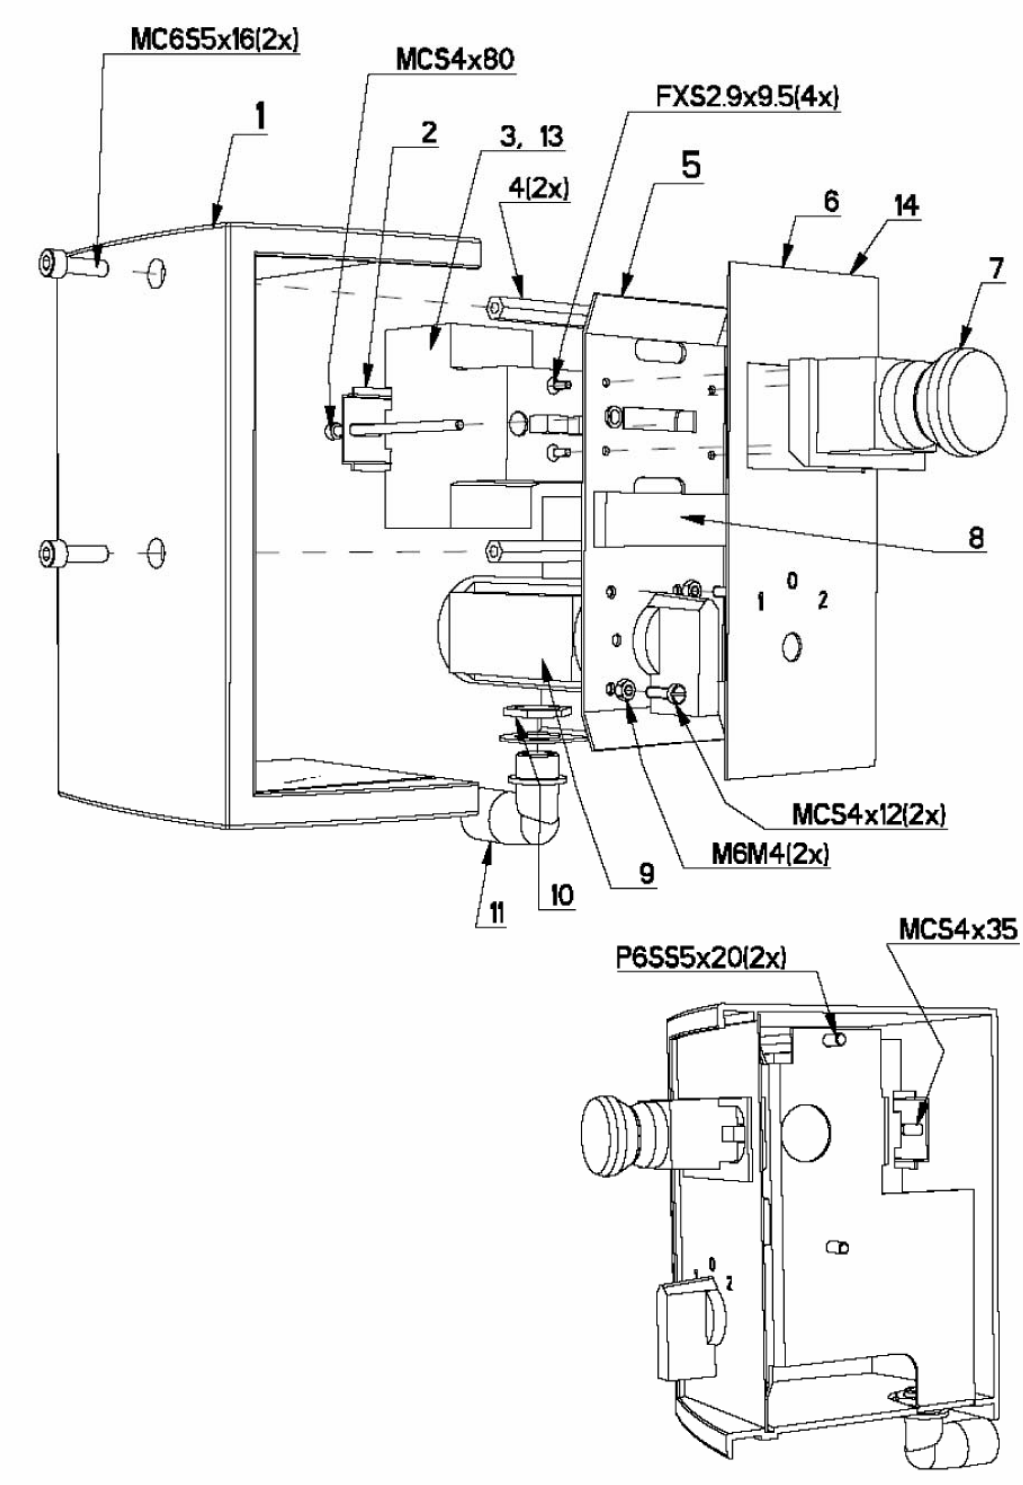

mmToolParts
Big Time Experience. Small Town Service. .com

JET J-A2608-4 | Stock 354029

Parts List K - Electric Box

Drill Press | Original JET parts reference

Ref.	Part number	Description	Size	Qty.
1	4U08705	Electric box cover		
2	2L08712	Rail anchor		
3	3E10600	Motor protector		
4	2E08713	Electric box distance tube		
5	4L08706	Anchor plate		
6	4L09711-1	Electric box plate		
7	3E16227	Emergency stop		
8	3T18003	Rubber moulding		
9	3E06016	Pole reverser		
10	3E19083	Nut		
11	3E19225	Nipple		
13	3E10610	Under volt release		
14	4L09711-2	Electric box plate rev.	21	

English descriptions transcribed from the original multilingual JET parts reference. Size/notes retain original variant and quantity annotations; blank Qty means no separate quantity was supplied.

mmToolParts
Big Time Experience. Small Town Service. .com