
JET JWL-1015 | Stock 719100

Diagram A - JWL-1015 Lathe

Original JET parts reference | Match model, voltage and serial-number notes

16.1.1 JWL-1015 Lathe – Exploded View

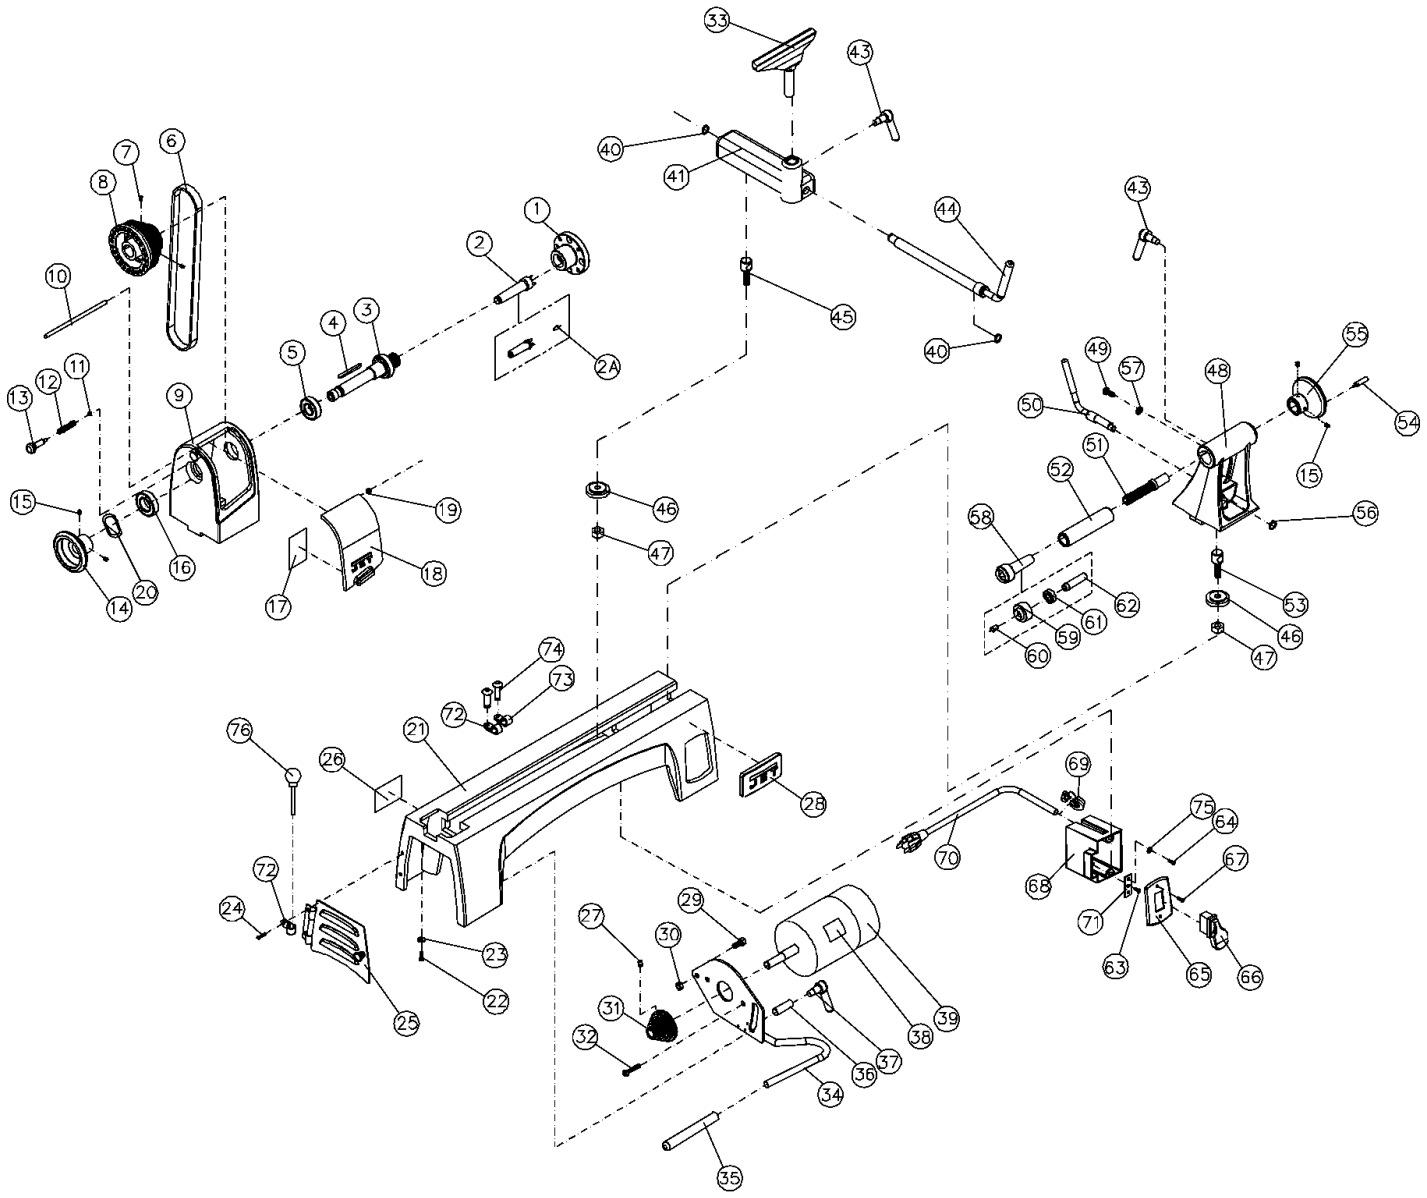

mmToolParts
Big Time Experience. Small Town Service. .com

JET JWL-1015 | Stock 719100

Parts List A - JWL-1015 Lathe

Original JET parts reference | Match model, voltage and serial-number notes

Ref.	Part number	Description	Size	Qty.
	JWL1015-HA	Headstock Assembly (includes #3 thru #20)		1
1	JML-2	Faceplate	3”	1
2	JML-3	Spur Center	MT2	1
2A	JML-3A	Center Point for Spur Center		1
3	JML-4	Spindle	1” x 8 TPI	1
4	JML-5	Key	5x25mm	1
5	BB-6005VV	Ball Bearing	6005VV	1
6	JML-20	V-Belt	240J	1
7	TS-0267041	Socket Set Screw	1/4”-20x3/8”	2
8	JWL1015-108	Spindle Pulley		1
9	JWL1015-109	Headstock		1
10	JWL1015-110	Pin		1
11	JML1014-187	C-Ring	STW-9	1
12	JML1014-188	Spring		1
13	JML1014-189	Index Pin		1
14	JWL1221VS-123	Handwheel		1
15	TS-0267021	Set Screw	1/4”-20x1/4”	4
16	BB-6004VV	Ball Bearing	6204VV	1
17	JWL1015-117	Speed Label		1
18	JWL1015-118	Pulley Access Door		1
19	JWL1015-119	Spring		1
20	JML-8	Wave Washer		1
21	JWL1015-121	Bed		1
22	TS-0207061	Socket Head Cap Screw	1/4”-20x1”	4
23	TS-0720071	Lock Washer	1/4”	4
24	JWL1015-124	Socket Head Button Screw	#10-24x1/4”	2
25	JWL1015-125	Motor Access Door		1

mmToolParts
Big Time Experience. Small Town Service. .com

JET JWL-1015 | Stock 719100

Parts List A - JWL-1015 Lathe (continued)

Original JET parts reference | Match model, voltage and serial-number notes

Ref.	Part number	Description	Size	Qty.
26	JWL1015-126	I.D Label		1
27	TS-0267041	Socket Set Screw	1/4”-20x3/8”	2
28	JET-92	JET Logo with 3M Adhesive	92x38mm	1
29	TS-0051051	Hex Cap Screw	5/16”-18x1”	1
30	TS-0640081	Nylon Lock Hex Nut	5/16”-18	1
31	JML-28	Motor Pulley		1
32	JWL1015-132	Socket Head Flat Screw	1/4”-20x1/2”	2
33	JML-42	Tool Rest	6”	1
34	JWL1015-134	Motor Bracket		1
35	JWL1221VS-266	Rubber Cover		1
36	JWL1015-136	Bushing		1
37	JWL1015-137	Lock Handle Assembly, Motor Plate		1
38	JWL1015-138	Motor Label		1
39	JWL1015-139	Motor	1/2HP, 1Ph, 115V	1
	JML-35-1	Capacitor (not shown)	25µf,250 VAC	1
	JML-35-2	Capacitor Cover (not shown)		1
	JML-35-3	Motor Fan Cover (not shown)		1
	JWL1015-TBA	Toolrest Base Assembly (includes #40 thru #47)		2
40	JML-49	C-Ring	STW-12	2
41	JWL1015-141	Tool Rest Body		1
43	JML-59A	Lock Handle Assembly	5/16”-18x3/4”	2
44	JML-50	Eccentric Locking Rod		1
45	JML-43	Bolt		1
46	JML-44	Clamp		2
47	JML-81	Clamp Nut		2
	JWL1015-TA	Tailstock Assembly (includes #15,43,46 thru #57)		1
48	JWL1015-148	Tailstock		1
49	TS-0255031	Socket Head Button Screw	5/16”-18x5/8”	1

mmToolParts
Big Time Experience. Small Town Service. .com

JET JWL-1015 | Stock 719100

Parts List A - JWL-1015 Lathe (continued)

Original JET parts reference | Match model, voltage and serial-number notes

Ref.	Part number	Description	Size	Qty.
50	JML-58	Eccentric Rod, Tailstock		1
51	JWL1015-151	Lead Screw		1
52	JML-55	Quill		1
53	JML-64	Bolt		1
54	JWL1221VS-222	Handle		1
55	JWL1221VS-223	Handwheel		1
56	JML-63	C-Ring	STW-10	1
57	TS-0680031	Flat Washer	5/16”	1
58	708331	Live Center Assembly (includes #59 thru #62)		1
59	JML-52	Live Center Head		1
60	JML-52A	Center Point for Live Center		1
61	BB-6002ZZ	Ball Bearing	6002ZZ	1
62	JML-54	Live Center Shaft		1
63	JWL1015-163	Tapping Screw	M3.5x6mm	1
64	TS-1533032	Pan Head Screw	M5x10	2
65	JWL1015-165	Switch Cover		1
66	994534	On-Off Switch		1
67	TS-081C052	Pan Head Screw	#10-24x3/4”	2
68	JWL1015-168	Switch Box		1
69	JWL1221VS-320	Strain Relief	6B3-2	2
70	JWL1015-170	Power Cord		1
71	JWL1015-171	Ground Plate		1
72	JWL1015-172	Clamp	5/16”	2
73	JWL1221VS-276	Clamp	1/2”	1
74	TS-081C022	Pan Head Screw	#10-24x3/8”	2
75	TS-0733041	External Tooth Lock Washer	1/4”	2
76	JML-11	Knockout Rod		1
77	JWL1221VS-211	Warning Label (not shown)		1

mmToolParts
Big Time Experience. Small Town Service. .com